


OPERATION INSTRUCTIONS

 Start Button


 Stop Button

 Green LED


 Red LED

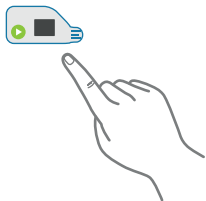


01 Keep green button pressed for minimum 5 seconds to start recording

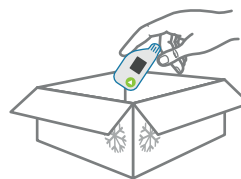

02 Add started **tempmate**.[®]-M2 to your shipment

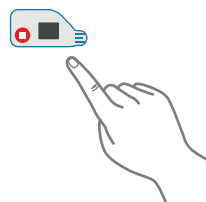

03 Keep red button pressed for minimum 5 seconds to stop recording

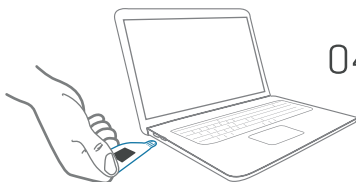

04 Connect stopped logger directly to USB port



05 The PDF report will be generated automatically




5 sec.

Start Logger




5 sec.

Stop Logger




2 times

Set Mark
Mark limit full





1 time

Not started
Low battery



Recording-OK
Recording-Alarm



Stopped-OK
Stopped-Alarm



For further information visit www.tempmate.com/M2